QG series

Discontinued: QG65 analog H-series. Successor: QG65N2 High accuracy series

QG65-KI-360H-AI-CM

Inclination sensor

1 axis vertical mounting

Factory programmable device
Output: 4 - 20 mA

Measuring range programmable between 1° and 360°

Measuring range
Factory default: ±180°



	General specifications 11377, v20241021
Housing	Reinforced plastic injection molded (Faradex DS, black, EMI shielded by stainless steel fiber in PC)
Dimensions (indicative)	60x50x27 mm
Mounting	Included: 4x M5x25 mm zinc plated steel pozidrive pan head screws, self-tapping (PZ DIN7500CZ) Mounting on flat surface only. Screw with care
Ingress Protection (IEC 60529)	IP67, IP69K (with IP69K mating connector)
Relative humidity	0 - 95% (non condensing, housing fully potted)
Weight	approx. 110 gram
Supply voltage	10 - 30 V dc
Polarity protection	Yes
Current consumption	≤ 25 mA (excluding output signal)
Operating temperature	-40 .. +85 °C
Storage temperature	-40 .. +85 °C
Measuring range	Factory default: ±180°
Centering function	Yes (12 mA = 0°), range 360°
Frequency response (-3dB)	0 - 10 Hz
Accuracy (overall @20°C)	0,07° typ.
Offset error	± 0,03° typ. (± 0,08° max) after centering
Non linearity	± 0,06° typ., ± 0,1° 2σ, ± 0,15° max.
Sensitivity error	not applicable. Repeatability 0,05°
Resolution	0,01°
Temperature coefficient	± 0,005°/K typ.
Max mechanical shock	20.000g
Output	4 - 20 mA
Output load	Rload ≤ (50*Vs -300) (Ω) (Eg: Vs = 24 V: Rload ≤ 900 Ω)
Short circuit protection	Yes (T<55°C), Max 10 s (T>55°C)
Output refresh rate	20 ms
Programming options	Factory programmable (measuring range, filtering)


LRI Distribuída no Brasil pela LRI | vendas@lri.com.br | 51 2129-3000

QG series

QG65-KI-360H-AI-CM

Iout = 12 + 8*(α/180) [mA]

Transfer characteristic

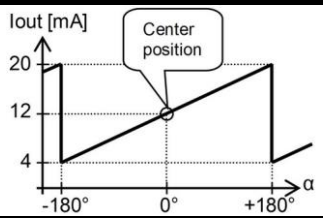

Rotation in vertical plane.

Lateral tilt sensitivity error:
< ± 0,03°/° lateral tilt (typ.)
Max. lateral tilt: 45°

Measurement orientation




Connectivity (cable length ±10%)

Connection


M12 male 8p A-coding connector (Brass Nickel coated, contacts copper alloy)

Wire / pin coding

Pin 1:	Output for factory use only
Pin 2:	Supply voltage
Pin 3:	for factory use only
Pin 4:	for factory use only
Pin 5:	Gnd
Pin 6:	Centering input
Pin 7:	Output
Pin 8:	not connected

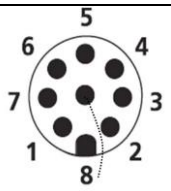

Mechanical dimensions (indicative only)

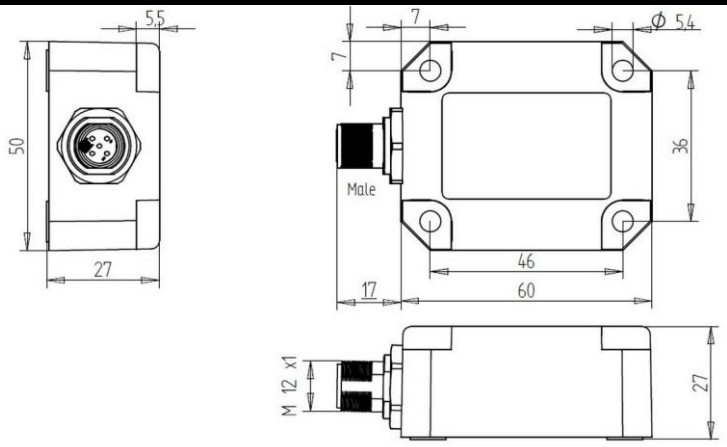

Center function

Centering can be done to eliminate mechanical offsets. To execute centering connect center input to ground (>0,5sec) within 1 min. after power up. After centering you have 1 min. left for another centering. Normally the center input should be left unconnected.

Optional: for accurate mounting two factory mounted positioning pins can be mounted (Ø4mm) replacing 2x M5x25 mm.

As this device is accelerometer-based the sensor is inherent sensitive for accelerations/vibrations. Application specific testing must be carried out to check whether this sensor will fulfil your requirements.

Distribuída no Brasil pela LRI | vendas@lri.com.br | 51 2129-3000